


can-am™



WARRANTY CAMPAIGN

ROADSTER WARRANTY Bulletin

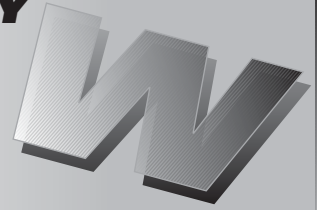

CAUTION: All involved customers must be notified, all involved units must be corrected as per instructions herein.

Campaign no.: 2012-0001

March 19, 2012

Subject: **Spyder™ RS – Lateral Support Bracket Modification**

No. **2012-1**

YEAR	MODEL	MODEL NUMBER	SERIAL NUMBER
2012	Spyder RS series	A1CA, A1CB, A1CC, A2CC, A2CD, A2CE, B1CA, B1CB, B1CC, B1CE, B1CF, B1CG, B1CH, B1CJ, B6CA, B6CC, B6CE, B6CF, B6CG	See attached list

PROBLEM

On some units, a bracket on the LH lateral support may contact an exhaust head pipe.


SOLUTION

Inspect the bracket area. Bend the bracket if necessary.

PROCEDURE


A video is available in the knowledge center for this procedure. See "RS lateral support modification"

1. Remove the LH middle side panel.

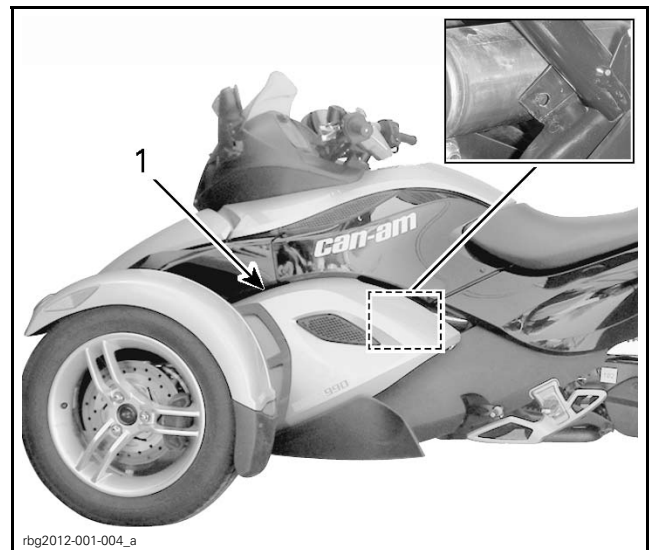


1. Middle side panel (remove)

2. Verify the clearance between the bracket and exhaust pipe.

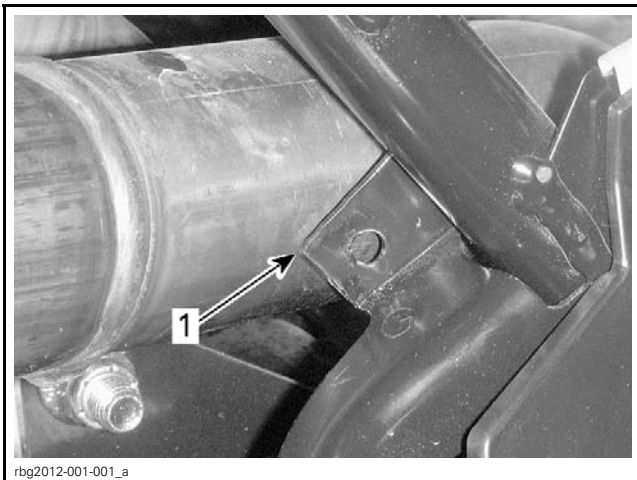

1. Minimum 7mm (1/4 in)

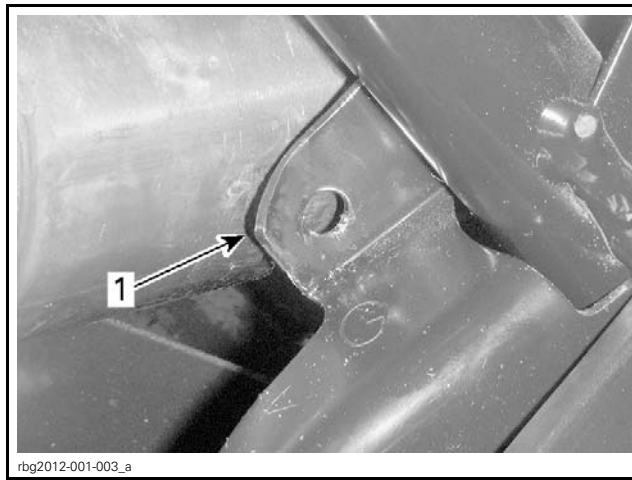

1. Bent bracket - minimum 7mm (1/4 in)

BRACKET INSPECTION	
At least 7 mm (1/4 in) clearance	No action required
Less than 7 mm (1/4 in) clearance	Modify bracket as follows

3. Bend bracket

3.1 Protect bracket and pipe finish with a rag.

3.2 Bend using suitable pliers



4. Reinstall panel.

WARRANTY

Submit a warranty claim using the following information:

CAMPAIGN NUMBER	2011-0001
Claim Type	Campaign claim
Action	Repair
Flat Rate Time	0.3 hour
Expiry Date	December 31 st 2014

Click in the REPAIR BOX while completing your claim on BOSSWeb.

REPAIR	✓
--------	---

For claiming procedure, refer to the *DEALER/DISTRIBUTOR WARRANTY GUIDE*.

LIST OF INVOLVED VEHICLES

Model: A1CA

From 000243 to 000278
From 000303 to 000304
From 000306 to 000309
From 000312 to 000338

Model: A1CB

000196
From 000198 to 000200
From 000202 to 000203
000217

Model: A1CC

000280
From 000283 to 000290

Model: A2CC

000291
From 000293 to 000295
From 000297 to 000299
From 000301 to 000302

Model: A2CD

000121
000123
000126
000130
000132

Model: A2CE

From 000133 to 000143
From 000145 to 000157
From 000160 to 000178
000180

Model: B1CA

From 000157 to 000166

Model: B1CB

000144
000153
000156

Model: B1CC

From 000313 to 000336
000373
000378
000382
From 000386 to 000387
From 000389 to 000402
From 000404 to 000410
From 000412 to 000420

Model: B1CE

From 000363 to 000374
000420
000432

Model: B1CE (cont'd)

000434
000442
From 000447 to 000453
From 000455 to 000463
From 000465 to 000470

Model: B1CF

000375
000381
000386

Model: B1CG

000121
From 000123 to 000132

Model: B1CH

From 000337 to 000340
From 000342 to 000343
From 000345 to 000347
From 000349 to 000357
From 000359 to 000360

Model: B1CJ

From 000339 to 000362

Model: B6CA

000170

Model: B6CC

From 000289 to 000300
From 000302 to 000303
From 000305 to 000312
000436
000442

Model: B6CE

From 000279 to 000280
From 000282 to 000327
From 000329 to 000338
From 000387 to 000390
From 000392 to 000398
000473
000478
000481

Model: B6CF

From 000402 to 000403
000406
000410

Model: B6CG

000367